

# DS5002FP Secure Microprocessor Chip

### www.maxim-ic.com

## **REVISION B3 ERRATA**

The errata listed below describe situations where DS5002FP revision B3 components perform differently than expected or differently than described in the data sheet. Dallas Semiconductor intends to fix these errata in subsequent die revisions.

This errata sheet only applies to DS5002FP revision B3 components. Revision B3 components are branded on the topside of the package with a six-digit code of the form yywwB3, where yy and ww are two-digit numbers representing the year and work-week of manufacture, respectively. To obtain an errata sheet on another DS5002FP die revision, visit the website at www.maxim-ic.com.

## 1. STATE OF CARRY BIT CAN CAUSE HIGH STOP MODE CURRENT

### **Description:**

Selection of Stop mode with the carry bit set will cause the I<sub>STOP</sub> parameter to be as high as 450µA.

## Work Around:

Clear the carry bit before selecting Stop mode.